



## Series IDPT Industrial Differential Pressure Transmitter

---


### QUICK START GUIDE

1. **Mount** transmitter with pressure ports facing down. Do not over-tighten mounting screws.
2. **Attach wires** following diagram on reverse side.
3. **Set Zero Calibration.** Apply zero pressure to both pressure ports on and pressing the zero button for 3 seconds.
4. **Scan** QR code with smart device to open the product web page for additional resources.




IDPT

## WIRING INFORMATION

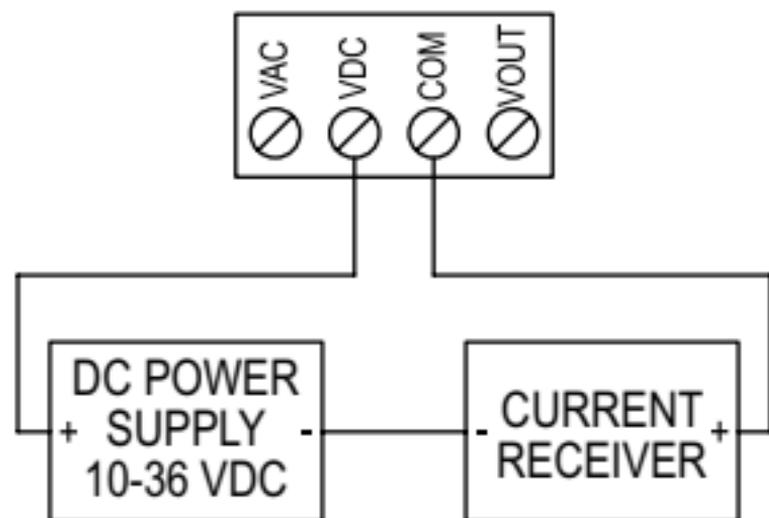

**4-20 mA**

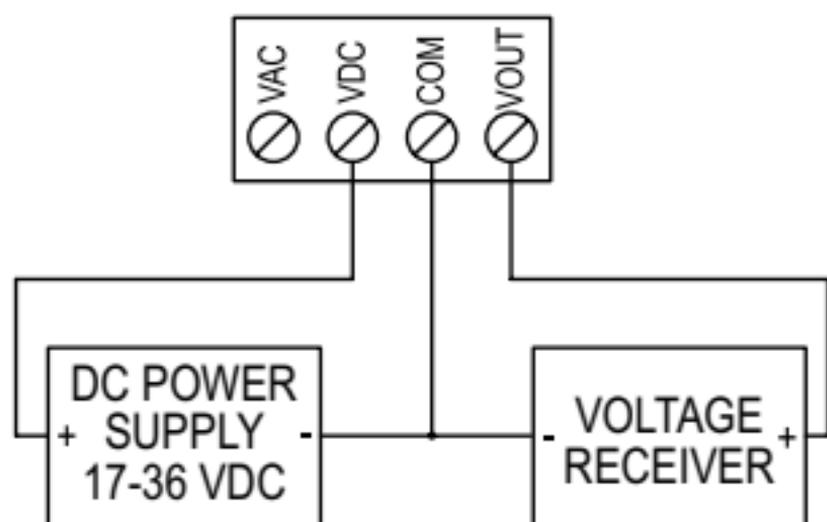

**3-wire voltage (with DC supply)**

See online User Guide for AC wiring.

Printed in U.S.A. 1/23

FR# 444691-00

©Copyright 2023 Dwyer Instruments, LLC